

KEY

WS = wrong side of fabric

RS = right side of fabric

(1) Cut out main fabric, lining and interfacing if used.

(2) If using Interfacing, attach to WS of main fabric and treat as one. Interfacing will not be mentioned again in these notes.

----- machine stitching




2.5 STITCH LENGTH

③

(3) On WS of main fabric and lining pieces, Fold back the four flaps to create window giving crisp corners. PRESS.

Window measures 8cms x 5cms

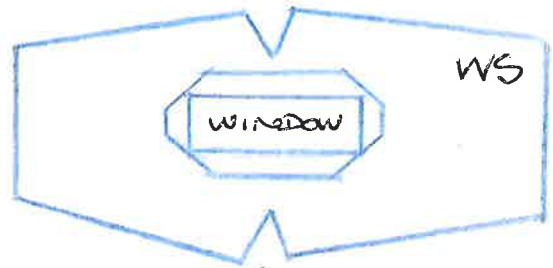


(4) Curve the corner edges of the plastic so nothing sharp and place over the window on WS of main fabric.

Fix temporarily with adhesive tape whilst sewing plastic to fabric very close to folded edges around window. Remove adhesive tape.

④ Close up of window

WS

Curve edges of plastic

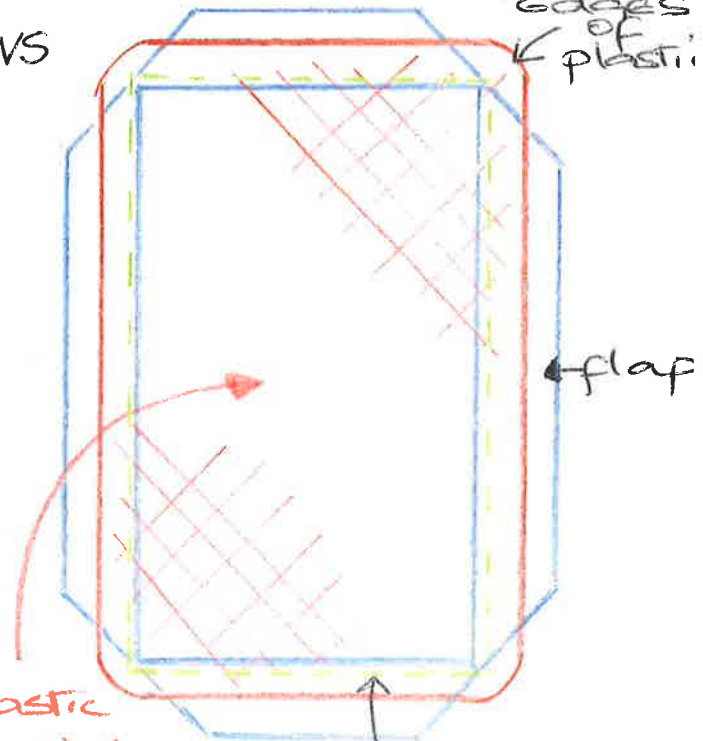


Plastic

Stitch close to fold

(9) Turn under 0.5cm of side raw edges to lining side. Press.

(10) Turn under again 2cms. Stitch next to inner fold to form casing, reinforcing well at both ends. Press.

(11) Insert elastic or ribbon/cord etc. into casing using safety pin.
If using elastic to form loop to go behind the ears, tie elastic using reef knot.
If using ribbon/cord etc. to be used around the head, place a small single knot at each end to prevent fraying or unravelling.

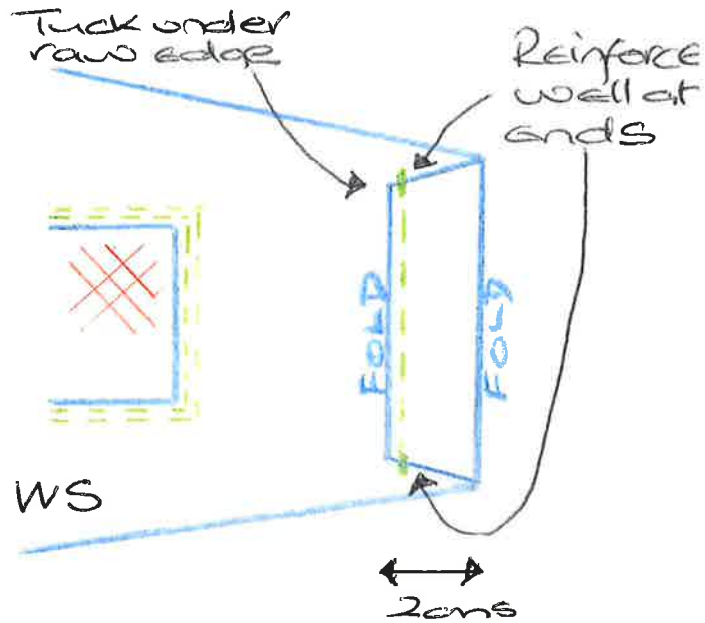

(12) When completed pack each individual mask in a new sealable bag....medium size food/freezer bags ideal..... and finally please insert note stating:

After washing at 60 degrees, smear a little dish/bar soap on inside of plastic and leave to dry. This helps prevent fogging